

**SECRET****PRIORITY***multi*  
**OUT58608****P 232318Z**

1966 MAY 23 23 42Z

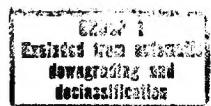
**FM NPIC WASHDC****TO RUCSC/SAC OFFUTT AFB OMAHA NEB  
RUCVAA/4080 STRAT WG OL 19 BARKSDALE AFB LA  
RUCVAA/2D RTS BARKSDALE AFB LA****RUEKDA/DIA WASHDC****RUECYH/NAVRECONTECHSUPPCEN SUITLAND MD****RUEPIA/CIA WASHDC****RUWBKN/15TH AF MARCH AFB RIVERSIDE CALIF****RUWGAA/2 AF BARKSDALE AFB LA****BT****S E C R E T CITE NPIC 7287.****15TH AF (FOR DI), SAC (FOR DIM/GOLDEN TREE/DOCR, DM 4) 2D AF (FOR DI).****24 MAY 1966****1. CAMERA B-125 WAS USED IN MISSION 8095 FLOWN ON 20 MAY  
1966. PROCESSING WAS ACCOMPLISHED BY BARKSDALE.****2. ORIGINAL NEGATIVE:**

**A. THE EXPOSURE WAS ADEQUATE AND THE RESOLUTION IS GOOD.**  
**B. 9R SIDE: SPOT STATIC OCCURS INTERMITTENTLY ALONG THE OUTBOARD EDGE THROUGHOUT THE MISSION. MINOR ROLLER CHATTER IS PRESENT ALONG THE INBOARD EDGE. EMULSION LIFTS ARE NOTED ON FRAMES 1541, 1542, 1770 AND 2144. A MANUFACTURING SPLICE IS LOCATED THROUGH FRAME 2266.**

**C. 9L SIDE: A STREAK OF FOG ALONG THE MINOR AXIS (PROBABLY DUE TO THE SIT PERIOD) IS PRESENT IN FRAME 0000. EDGE STATIC APPEARS ALONG BOTH EDGES. ROLLER CHATTER WAS NOTED INTERMITTENTLY ALONG THE INBOARD EDGE. STREAKS OF SMALL EMULSION ABRASIONS ALONG THE MINOR AXIS ARE PRESENT IN FRAMES 1499, 1798, AND 1799. SMALL EMULSION ABRASIONS ARE ALSO PRESENT IN FRAME 0301. FILM BUCKLING, PROBABLY ATTRIBUTED TO THE TAPE ALONG THE EDGES OF THE ULTRASONIC SPLICES, WAS NOTED IN FRAMES 1499 AND 2399. AN**

**SECRET**

DISTRIBUTION		
Off No.	Office	Action
1	FMS	
2	CS	
	ADMIN	
	SEC BR	
	P & DS	
	CSD	
	IPD	
	PD	
	PSD	
	PSD-ICB	
345	TID	
77	IAD	
	PAG	
	DIAXX-4	
	SPAD	
	NSA-LO	
	DIA-AP	

**Advance copy  
Sanitized**

--2--

EMULSION DEFECT WAS FOUND IN FRAME 2256. INK TRANSFER FROM THE LEADER IS PRESENT IN FRAME 1500. SEVERE CREASING WAS NOTED IN FRAMES 0615 AND 0616. TWO TEARS REPAIRED WITH TAPE ON THE BASE SIDE ARE ALSO PRESENT IN FRAME 0615. TITLE FLAKING OCCURS IN VARYING DEGREES THROUGHOUT. A MANUFACTURER'S SPLICE WITH ITS ASSOCIATED DEGRADATION APPEARS IN FRAME 0137.

D. BOTH SIDES: THE MISSION IS TITLED FROM 0000 THROUGH 2551.

E. THERE WERE NO MAJOR CAMERA OR PROCESSING MALFUNCTIONS.

3. POSITIVE:

- A. PI SUITABILITY IS GOOD.
- B. PRINTING AND PROCESSING WERE GOOD.
- C. CLOUDS AND HAZE DEGRADE APPROXIMATELY 20 PERCENT OF THE MISSION.

GP-1

S E C R E T

-END OF MESSAGE-